

INSTALLATION RESTORATION PROGRAM
FINAL
NO FURTHER REMEDIAL ACTION PLANNED
DECISION DOCUMENT
SITE 26



MINNESOTA AIR NATIONAL GUARD
148th FIGHTER WING
DULUTH, MINNESOTA

19980617 013

Prepared For:

Air National Guard
Andrews AFB, Maryland

March 1998

DTIC QUALITY INSPECTED 1

DISTRIBUTION STATEMENT A

Approved for public release;
Distribution Unlimited

REPORT DOCUMENTATION PAGE			Form Approved OMB No. 0704-0188	
Public reporting burden for this collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to Washington Headquarters Services, Directorate for Information Operations and Reports, 1215 Jefferson Davis Highway, Suite 1204, Arlington, VA 22202-4302, and to the Office of Management and Budget, Paperwork Reduction Project (0704-0188), Washington, DC 20503.				
1. AGENCY USE ONLY (Leave blank)		2. REPORT DATE March 1998		3. REPORT TYPE AND DATES COVERED Decision Document
4. TITLE AND SUBTITLE No Further Response Action Planned Decision Document for Site 26 at Minnesota Air National Guard, Duluth International Airport, Duluth, MN			5. FUNDING NUMBERS	
6. AUTHOR(S) N/A				
7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES) Montgomery Watson Minneapolis, MN			8. PERFORMING ORGANIZATION REPORT NUMBER	
9. SPONSORING/MONITORING AGENCY NAME(S) AND ADDRESS(ES) ANG/CEVR 3500 Fetchet Avenue Andrews AFB, MD 20762-5157			10. SPONSORING/MONITORING AGENCY REPORT NUMBER	
11. SUPPLEMENTARY NOTES				
12a. DISTRIBUTION AVAILABILITY STATEMENT Approved for public release distribution is unlimited			12b. DISTRIBUTION CODE	
13. ABSTRACT (Maximum 200 words) No Further Response Action Planned Decision Document for Site 26. This document presents the rational for selecting no Further Response Action as the proper remedial action at the site.				
14. SUBJECT TERMS Installation Restoration Program; Decision Document; Air National Guard; 148th FW, Duluth, MN			15. NUMBER OF PAGES 20	
			16. PRICE CODE	
17. SECURITY CLASSIFICATION OF REPORT Unclassified	18. SECURITY CLASSIFICATION OF THIS PAGE Unclassified	19. SECURITY CLASSIFICATION OF ABSTRACT Unclassified	20. LIMITATION OF ABSTRACT no	

INSTALLATION RESTORATION PROGRAM
FINAL
NO FURTHER REMEDIAL ACTION PLANNED
DECISION DOCUMENT
SITE 26



MINNESOTA AIR NATIONAL GUARD
148th FIGHTER WING
DULUTH, MINNESOTA

Montgomery Watson Contract No. DAHA90-94-D-0013
Delivery Order No. 35
Montgomery Watson File No. 1257016.351802

Prepared For:

Air National Guard
Andrews AFB, Maryland

Prepared By:

Montgomery Watson
Minneapolis, Minnesota

March 1998

TABLE OF CONTENTS

1.0	INTRODUCTION.....	1
2.0	SITE DESCRIPTION AND HISTORY.....	2
2.1	DESCRIPTION.....	2
2.2	HISTORY.....	2
3.0	SUMMARY OF INVESTIGATIONS.....	5
4.0	CONTAMINATION ASSESSMENT.....	6
5.0	CONCLUSIONS.....	8
6.0	DECISION.....	9
7.0	REFERENCES.....	10

LIST OF TABLES

Table 1	Summary of Investigation Results.....	7
---------	---------------------------------------	---

LIST OF FIGURES

Figure 1	Base Location Map.....	3
Figure 2	Site 26 Location.....	4

LIST OF ACRONYMS

ug/kg	micrograms per kilogram
ug/L	micrograms per liter
AFB	Air Force Base
ANG	Air National Guard
ARAR	applicable and relevant or appropriate requirements
BTEX	benzene, toluene, ethylbenzene, and xylenes
DIA	Duluth International Airport
DOD	Department of Defense
FW	Fighter Wing
GC	gas chromatograph
HRL	Health Risk Limit
IRP	Installation Restoration Program
MCL	Maximum Contaminant Level
mg/kg	milligrams per kilogram
NGVD	National Geodetic Vertical Datum
PA	Preliminary Assessment
PCBs	polychlorinated biphenyls
pCi/g	picocuries per gram
pCi/L	picocuries per liter
ppm	parts per million
RI	Remedial Investigation
SI	Site Investigation
SVOCs	semivolatile organic compounds
VOCs	volatile organic compounds

1.0 INTRODUCTION

This decision document presents the rationale for the decision of no further remedial action which is proposed for Site 26, Ramp Disposal Area, at the Minnesota Air National Guard (ANG), 148th Fighter Wing (Base) located at the Duluth International Airport (DIA) in Duluth, Minnesota. This document is part of the U.S. Department of Defense's (DOD's) Installation Restoration Program (IRP).

2.0 SITE DESCRIPTION AND HISTORY

The Base is located in St. Louis County at the DIA approximately seven miles northwest of the City of Duluth. The regional location of the Base is shown on Figure 1. DIA occupies approximately 2,000 acres of land. The Base occupies buildings on the east side of the airport facility with some additional buildings and functions at other locations.

The airport has been used for military operations since 1948. From 1948 to 1961, the airport was used by the 179th Fighter Squadron, which was part of the 133rd Fighter Wing (FW) of the Minnesota ANG. From 1961 to 1995, the 148th Fighter Group of the Minnesota ANG was active at the airport. In 1995, the 148th Fighter Group was redesignated the 148th FW which continues operation at the airport today.

This section presents a site description and history for Site 26 at the Base in Duluth, Minnesota. Figure 2 shows the location of Site 26 , Ramp Disposal Area, on the Base.


2.1 DESCRIPTION

Site 26 is adjacent to the aircraft ramp located west of Buildings 499 and 500 (Figure 2). The site encompasses an area of approximately 0.5 acres and was used in the 1960s and 1970s to store 55-gallon drums of contaminated aircraft fuel. Buckets of contaminated aircraft fuel were reportedly disposed onto the soil surface along the edge of the ramp.

Site 26 is 10 to 20 feet higher than the terrain to the east and south of the Base. Topography to the east of the Base is more pronounced, as the elevated hill drops off sharply to an area of a marshy area which drains into the nearby Miller Creek. The elevation of the Base is approximately 1,420 feet above the National Geodetic Vertical Datum of 1929 (NGVD).

2.2 HISTORY

The non-paved area west of the aircraft ramp and Building 500 is designated IRP Site No. 26 (Figure 2.2). Reportedly, waste fuel from aircraft operations was stored in 55-gallon drums along the ramp in the 1960s and 1970s. Additionally, small amounts of waste fuel from aircraft were disposed of by dumping the waste fuel in the dirt along the edge of the ramp. According to former aircraft maintenance personnel, this resulted in the soil becoming discolored (i.e., black) along the ramp edge.

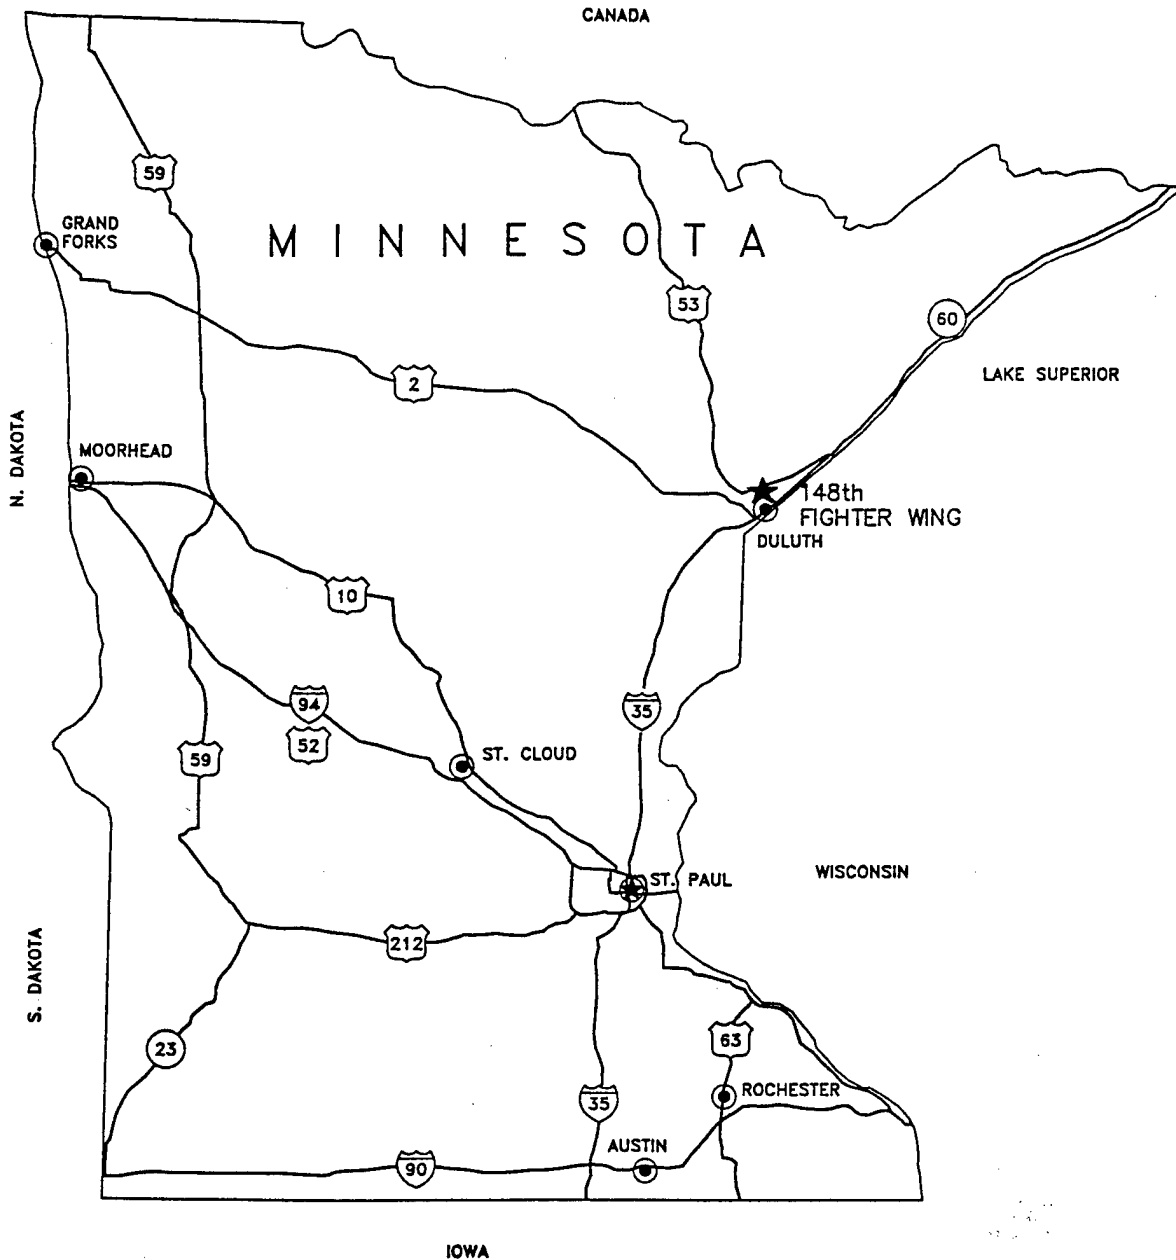

0 30 60
Scale in Miles




SOURCE: RAND McNALLY ROAD ATLAS, 1992.

MINNESOTA ANG, 148TH FIGHTER WING
DULUTH INTERNATIONAL AIRPORT
DULUTH, MINNESOTA

FIGURE 1
BASE LOCATION MAP



MONTGOMERY WATSON

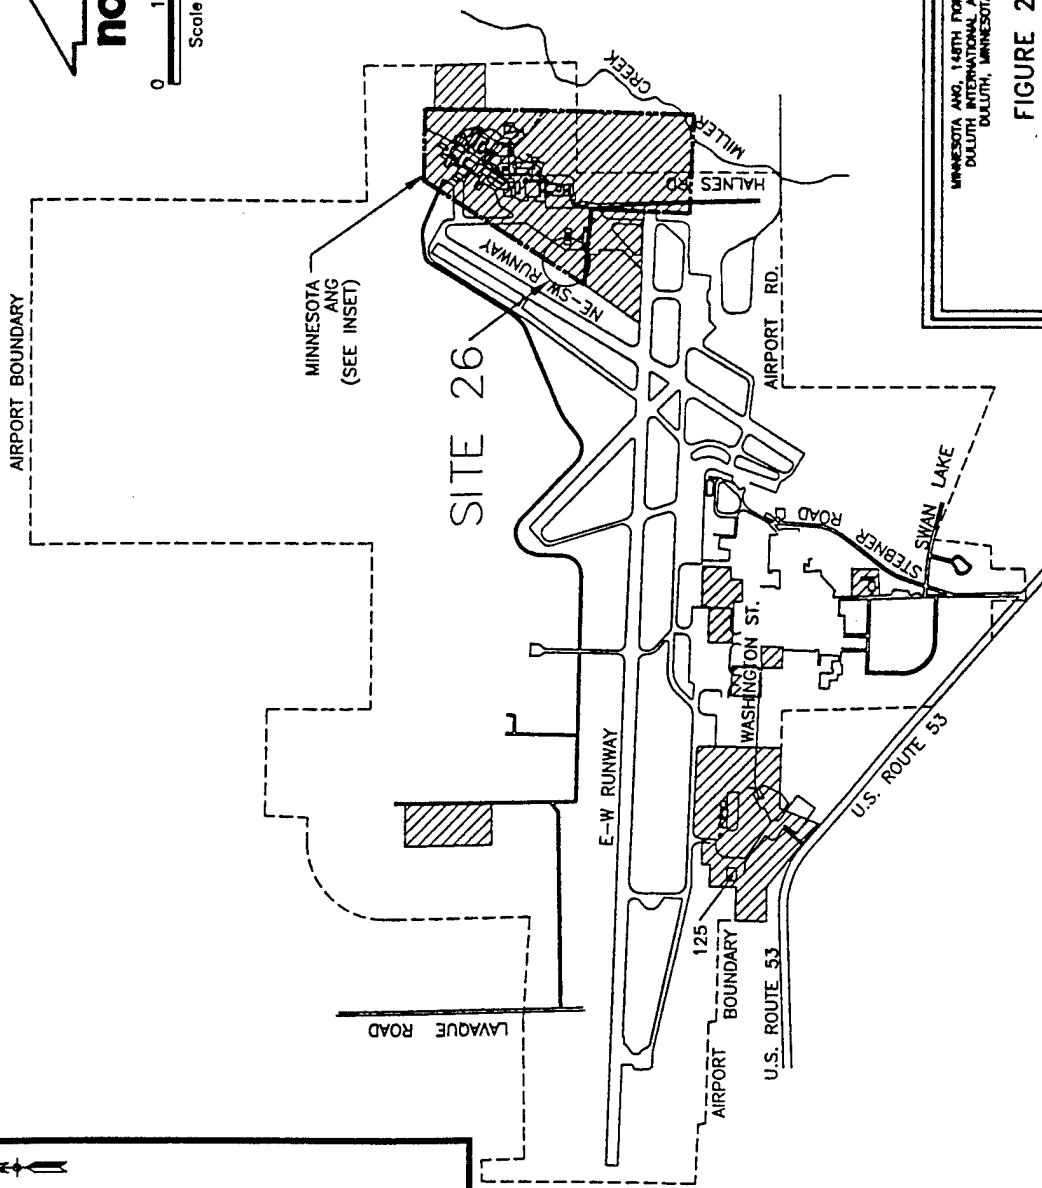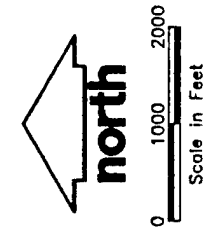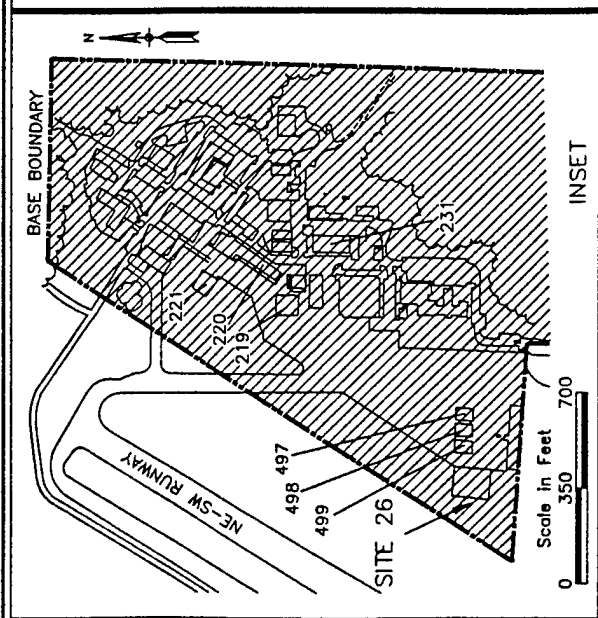

- LEGEND**
- MINNESOTA ANG BOUNDARY
 - AIRPORT BOUNDARY
 - ANG LEASED PROPERTY
 - 125 BUILDING/BUILDING NUMBER
 - TREE LINE

SOURCE: ENGINEERING-SCIENCE, INC., REMEDIAL INVESTIGATION REPORT, JANUARY 1990.

MINNESOTA ANG, 148TH FIGHTER WING
DULUTH INTERNATIONAL AIRPORT
DULUTH, MINNESOTA

FIGURE 2

SITE 26 LOCATION



3.0 SUMMARY OF INVESTIGATIONS

A Preliminary Assessment (PA) was conducted at the Base in February 1993, and finalized in August 1993 (Optech, 1993). Information obtained through interviews, review of base records, and field observations resulted in the identification of IRP Site 26 (Ramp Disposal Area).

A Site Investigation (SI) was conducted to confirm the presence or absence of contamination at Site 26. The field investigation for the SI commenced on May 2, 1995 and was completed on May 20, 1995 (Optech, 1996).

The field investigation at Site 26 included drilling six soil borings to obtain soil samples for laboratory analyses. Soil borings were drilled to depths ranging from 7 to 12 feet below grade. A field gas chromatograph (GC) was used to screen soil samples for benzene, toluene, ethylbenzene, and xylenes (BTEX). Samples were also submitted for laboratory analysis. Sample results were used to determine contaminant concentrations, to delineate vertical and horizontal extent of soil contamination at the site, and to evaluate the potential for contaminant impact to groundwater. Soil samples were analyzed for volatile organic compounds (VOCs), semivolatile organic compounds (SVOCs), and metals.

The field investigation also included installing three monitoring wells to obtain groundwater samples for laboratory analyses and data for hydrogeologic characterization of the hydrologic unit. One round of groundwater samples was collected. Samples were analyzed for VOCs and SVOCs.

4.0 CONTAMINATION ASSESSMENT

This section discusses the nature and extent of contamination at Site 26. Table 1 presents a summary of results and the associated applicable and relevant or appropriate requirements (ARARs).

Contaminant concentrations were detected at low levels in the soil. Using the field GC, benzene, toluene, ethylbenzene, m,p-xylene, and o-xylene were detected in soil samples at maximum concentrations of 0.011 milligrams per kilogram (mg/kg), 0.006 mg/kg, 0.017 mg/kg, 0.026 mg/kg, and 0.006 mg/kg, respectively. Benzene, toluene, and ethylbenzene were detected at maximum concentrations of 0.01 mg/kg, 0.002 mg/kg, and 0.003 mg/kg, respectively, in groundwater samples. M,p-xylene and o-xylene were not detected in groundwater samples using field GC.

Toluene was detected by laboratory analysis in a duplicate soil sample at a concentration of 0.007 mg/kg, slightly exceeding the analytical detection limit of 0.005 mg/kg. This sample was collected at a depth of 2 to 2.5 feet below grade near the ramp. Toluene was not detected in the original sample. Three SVOCs were detected in a near-surface soil sample collected from a second soil boring near the ramp. Fluoranthene, phenanthrene, and pyrene were detected at 0.870 mg/kg, 0.800 mg/kg, and 0.710 mg/kg, respectively, in a sample collected from a depth of 2 to 2.5 feet below grade. Chromium and lead concentrations were detected at concentrations below background levels.

The maximum concentrations of benzene, ethylbenzene, and toluene detected in groundwater by laboratory analysis were 0.01 microgram per liter (ug/L), 0.003 ug/L, and 0.002 ug/L, respectively. Phenol was detected in all three groundwater samples at a concentration of 51 ug/L. None of these concentrations exceed ARARs.

TABLE 1

**SUMMARY OF INVESTIGATION RESULTS
MINNESOTA AIR NATIONAL GUARD
148TH FIGHTER WING
DULUTH, MINNESOTA**

Selected Analytes	Maximum Detected Concentration	Background Concentrations	Potential ARAR	Source of ARAR	ARAR Exceeded
<u>Groundwater</u>					
Benzene	0.01 ug/l	*	5 ug/L	MCL	No
Ethylbenzene	0.003 ug/L	*	700 ug/L	MCL	No
Toluene	0.002 ug/L	*	1,000 ug/L	HRL	No
Xylenes (Total)	ND	*	10 ug/L	MCL	No
Phenol	51 ug/L	*	4,000 ug/L	MCL	No
<u>Soil</u>					
Toluene	0.007 mg/kg	*	*	*	*
Fluoranthene	0.870 mg/kg	*	*	*	*
Phenanthrene	0.800 mg/kg	*	*	*	*
Pyrene	0.710 mg/kg	*	*	*	*
Chromium	13 mg/kg	42.2 mg/kg	*	*	*
Lead	5.9 mg/kg	9.9 mg/kg	100 mg/kg	¹ State	No

Notes:

* - Information not available

¹ State of Minnesota Lead Abatement Standard

HRL - Minnesota Department of Health, Health Risk Limit

MCL - Maximum Contaminant Level

ARAR - Applicable or Relevant and Appropriate Requirement

NA - Not analyzed

ND - Not detected

ug/L - micrograms per liter


mg/kg - milligrams per kilogram

5.0 CONCLUSIONS

No significant soil and groundwater contamination was found at Site 26. Toluene slightly exceeded the detection limit in a duplicate shallow soil sample but not in the original sample. Low levels of three SVOCs were detected in a near-surface soil sample near the ramp. No concentrations exceeded ARARs for soil or groundwater. The SI recommended no additional investigation or remedial action for Site 26.

6.0 DECISION

Based on the findings of the site investigation, conditions do not pose a health threat at the site; therefore, no remedial action is necessary to ensure protection of human health or the environment at Site 26. This site will be removed from further consideration in the IRP process, and no further investigative or remedial activities will be conducted with regard to Site 26.

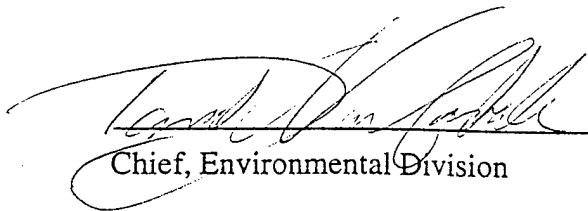


Chief, Environmental Division

11 Apr 98

Date

Minnesota Pollution Control Agency

☒ Concur
☐ Non-Concur (please provide reason)



Signature

Project Manager

Title

4/28/98

Date

7.0 REFERENCES

Operational Technologies Corporation (OpTech), 1993. Installation Restoration Program, Preliminary Assessment of the 148th Fighter Group Report, 148th Fighter Group, Minnesota Air National Guard, Duluth Air National Guard Base, Duluth, Minnesota.

Operational Technologies Corporation (Optech), 1996. Site Investigation Report for IRP Sites No. 25 and No. 26, 148th Fighter Wing, Minnesota Air National Guard, Duluth Air National Guard Base, Duluth, Minnesota. June.